

III GB - Report Period: APR 2011
Status Of Reported Tests

STATUS	COUNT	PERCENT
Aborted	18	13.846
Cancelled	1	0.769
Invalid	2	1.538
Special Case. Do Not MTAC	1	0.769
Valid	108	83.077
Total Reported Tests	130	100.000

IIIGB - Report Period: APR 2011
Itemized Lost Test Report

Obs	Date	TESTKEY	REASON
1	20101001	ACC-6324	Test Was Terminated At 92 Hours Due To A Failed Head Gasket.
2	20101011	ACC-6448	Test Terminated At 93 Hours Due To Loss Of Oil Temperature Control.
3	20101012	ACC-6432	Test Terminated At Test Hour 96 Due To Blown Head Gasket.
4	20101029	ACC-6563	Test Terminated At Test Hour 88 Due To Scuffed Piston.
5	20101103	ACC-6603	Test Was Terminated At Test Hour 99 At Sponsor'e Request
6	20101105	ACC-6621	Test Was Terminated By Lab At 98 Hours Due To Loss Of Oil Temperature Control.
7	20101108	ACC-6626	Test Terminated At Test Hour 99 Due To Blown Head Gasket.
8	20101112	ACC-6667	Test Invalid Due To Main Bearing Failure.
9	20101112	ACC-6662	Test Was Non-Interpretable Due To Oil Consumption Greater Than 4.89 Liters.
10	20101116	ACC-6688	Test Terminated At Test Hour 90 Due To Stuck Rings.
11	20101129	ACC-6802	Test Terminated At Test Hour 93 Due To Loss Of Oil Temperature Control
12	20101130	ACC-6798	Test Terminated At Test Hour 97 Due To A Blown Head Gasket.
13	20101203	ACC-6859	This Test Is Invalid Due To Excessive Main And Rod Bearing Wear.
14	20101206	ACC-6885	Test Was Terminated By Lab At 95 Hours Due To Loss Of Oil Temperature Control.
15	20101207	ACC-6899	Test Was Terminated At Test Hour 98 Due To Zero Oil Pressure, Caused By Excessive Oil Thickening.
16	20101215	ACC-6969	Test Was Terminated At Test Hour 99 Due To Loss Of Oil Temperature Control.
17	20101217	ACC-6997	Test Was Terminated At 96 Hours Due To Head Gasket Failure.
18	20101221	ACC-7043	Test Was Terminated At Test Hour 94 Due To Loss Of Oil Temperature Control.
19	20110120	ACC-7231	Test Terminated At Test Hour 83 Due To Blown Head Gasket.
20	20110125	ACC-7264	Test Was Terminated At Start Of Test Due To Connecting Rod Bearing Failure.
21	20110201	ACC-7303	Test Was Terminated At Test Hour 56 Due To Excess Oil Consumption, Caused Intake Valve Stem Seals
22	20110310	ACC-7531	Test Terminated At Test Hour 82 Due To Blown Head Gasket.

IIIGB - Report Period: APR 2011
Replicate Database Report

Components of Replicate Database	APR 2011	All Periods
Number of Tests	2	28
Formulations	1	13
Labs	2	5
Stands	2	12

IIIGB - Report Period: APR 2011
by-Formulation Pooled s and Reproducibility of Replicate Data

Report Period	Parameter	Degrees of Freedom	Pooled s	R
APR 2011	PHOS	1	0.07778	0.21779
APR 2011	PHOS (Without SA)	1	0.07778	0.21779
All	PHOS	15	1.84925	5.17790
All	PHOS (Without SA)	15	1.79024	5.01267

III GB - Report Period: APR 2011
Pass/Fail

Report Period	API Category	N	Number Passed	% Passed
APR 2011	All Categories, All Parameters	108	105	97.2222
APR 2011	GF-5 - All Parameters	108	105	97.2222
APR 2011	GF-5, PHOS	108	105	97.2222
APR 2011	GF-5, PHOS (Without SA)	108	102	94.4444
All	All Categories, All Parameters	570	542	95.0877
All	GF-5 - All Parameters	570	542	95.0877
All	GF-5, PHOS	570	542	95.0877
All	GF-5, PHOS (Without SA)	570	471	82.6316




Monitoring Agency

6555 Penn Avenue, Pittsburgh, PA 15206

<https://acc-ma.org>

IIIGB

Status of Reported Tests

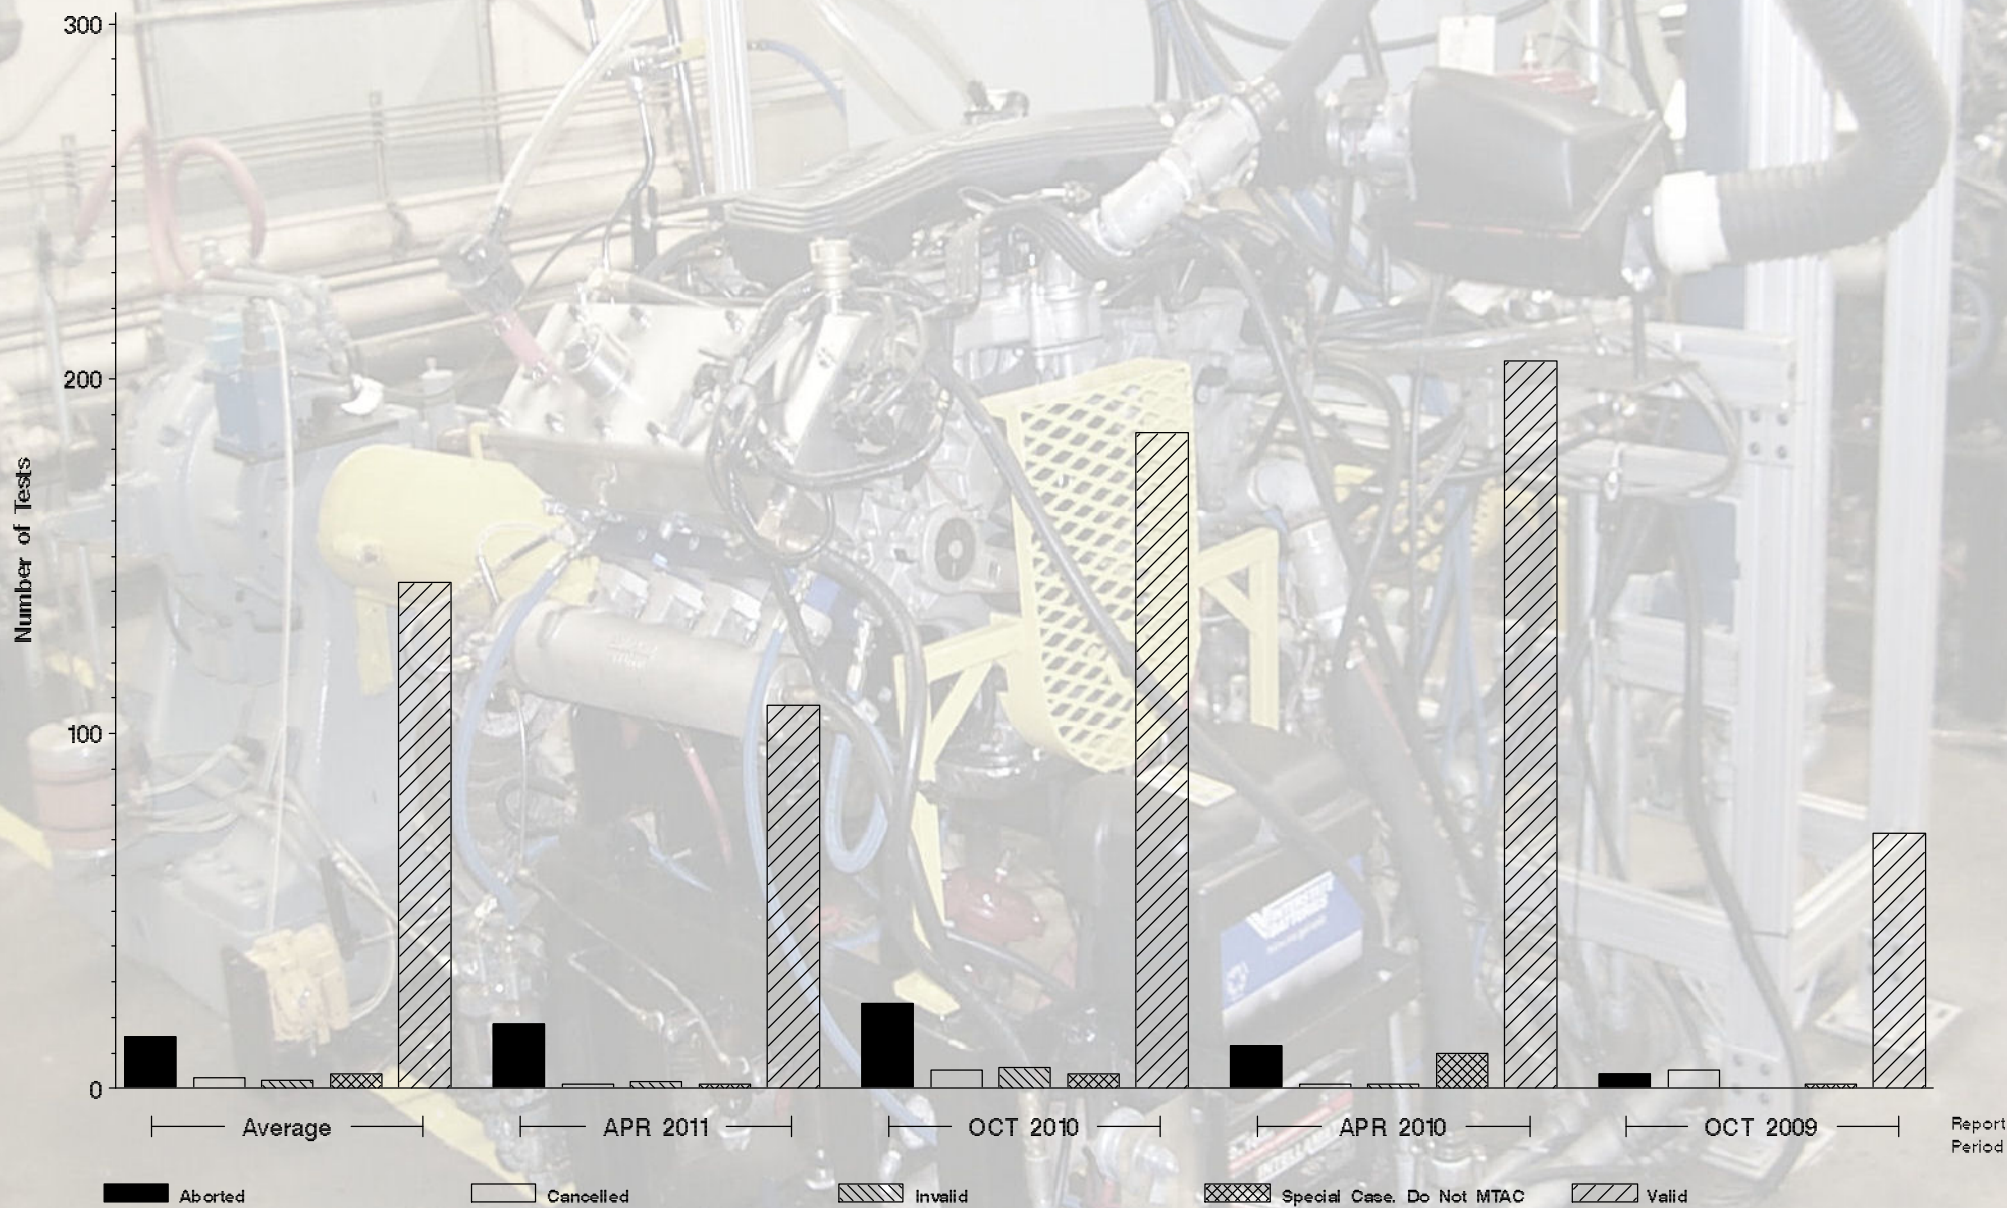




Monitoring Agency

6555 Penn Avenue, Pittsburgh, PA 15206

<https://acc-ma.org>

IIIGB

Candidate Precision as Represented by Pooled S

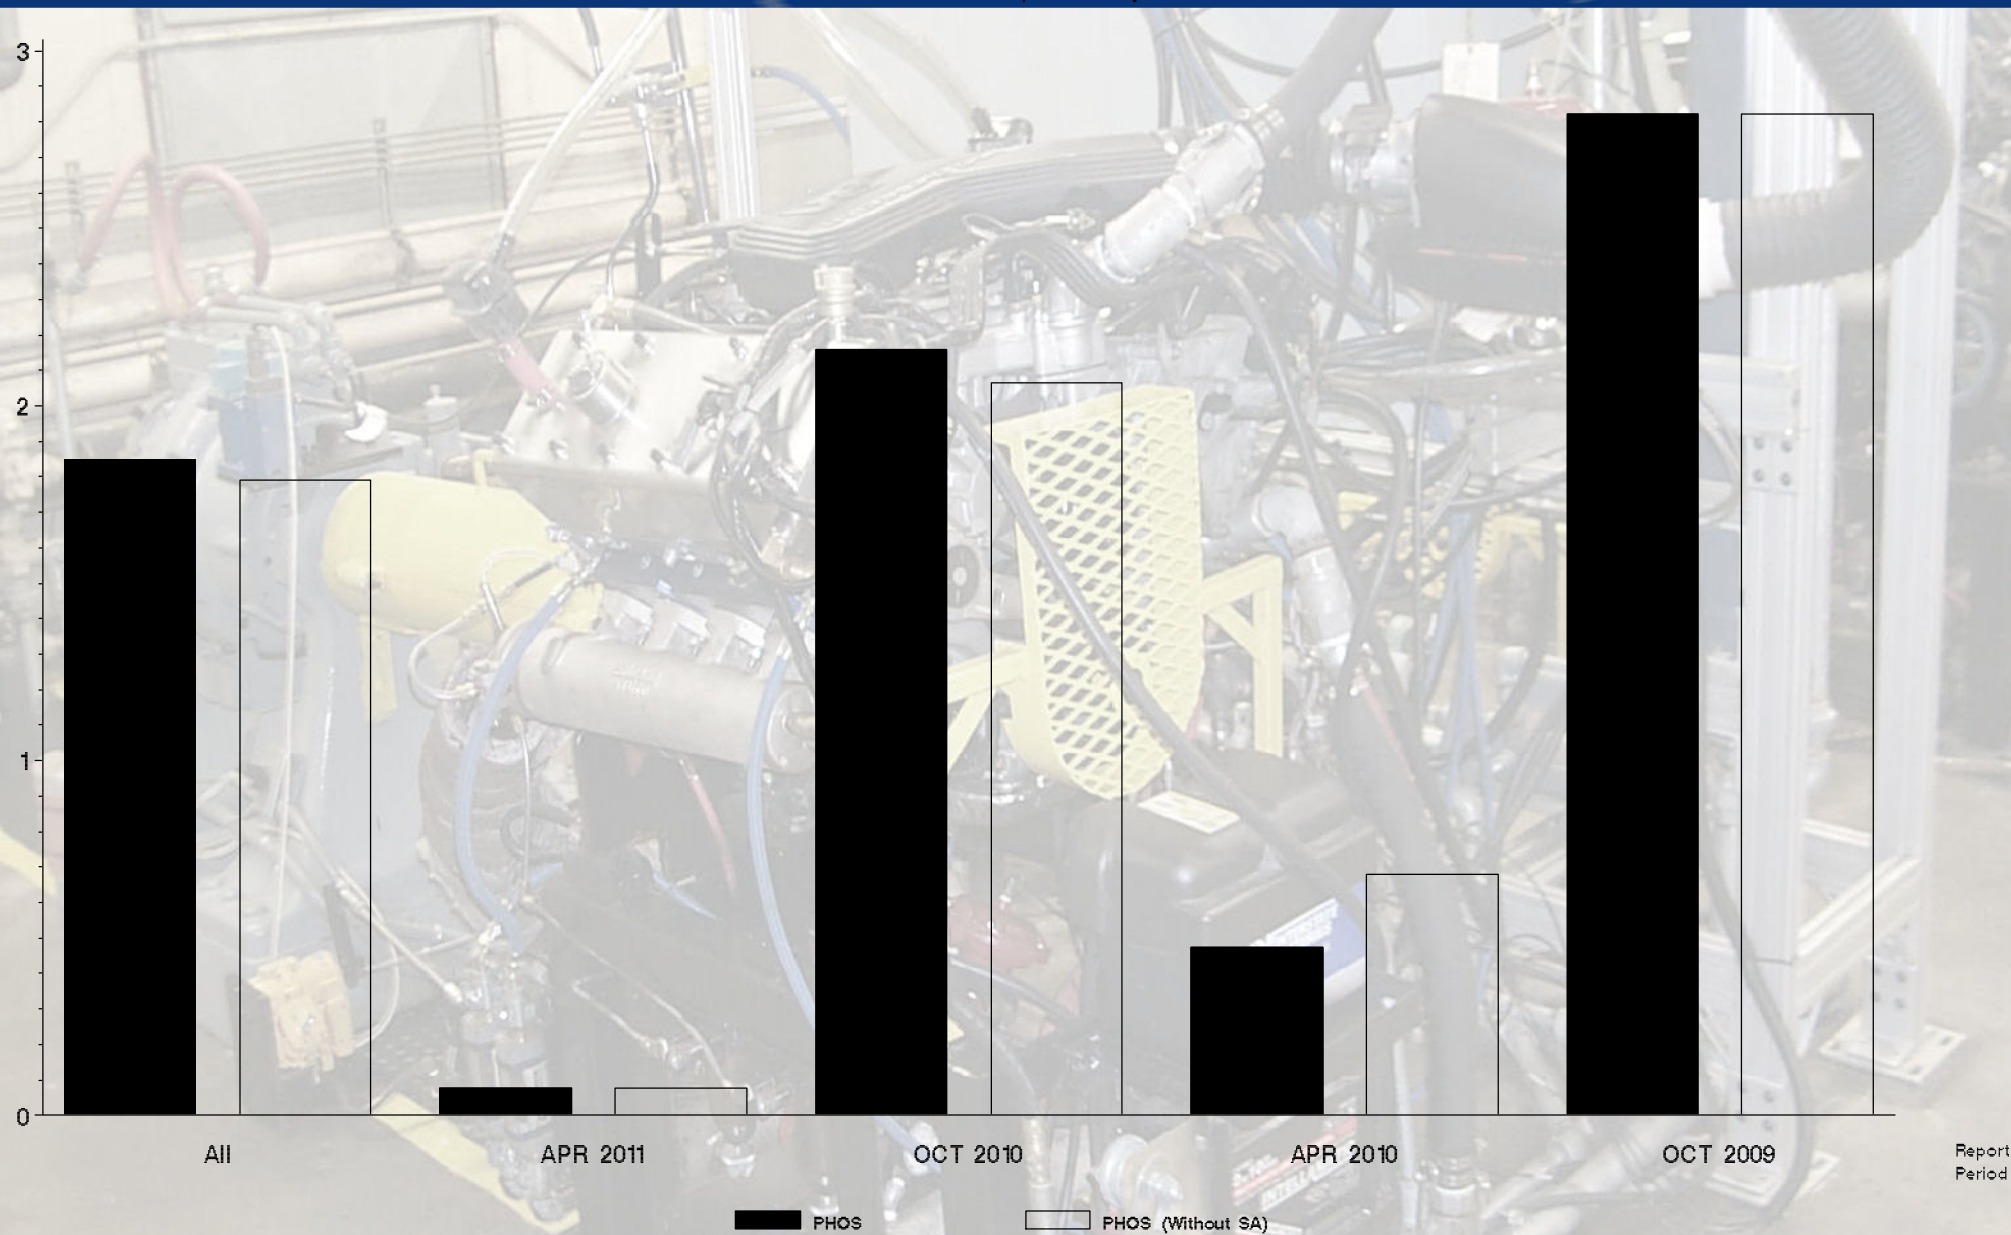



Monitoring Agency

6555 Penn Avenue, Pittsburgh, PA 15206

<https://acc-ma.org>

IIIGB

Candidate Precision as Represented by Pooled S

