

***IIIGB - Report Period: OCT 2011***  
***Status Of Reported Tests***

STATUS	COUNT	PERCENT
Aborted	17	14.912
Invalid	2	1.754
Special Case. Do Not MTAC	1	0.877
Valid	94	82.456
Total Reported Tests	114	100.000

**IIIGB - Report Period: OCT 2011**  
**Itemized Lost Test Report**

Obs	Date	TESTKEY	REASON
1	20110406	ACC-7675	Test Terminated At Test Hour 90 Due To Loss Of Oil Temperature Control Caused By High Oil Consumptio
2	20110418	ACC-7707	Test Was Terminated At Test Hour 94 Due To Blown Head Gasket.
3	20110429	ACC-7806	Test Was Terminated At Test Hour 83 Due To Excessive Blowby And Loss Of Oil Temperature Control.
4	20110519	ACC-7884	Test Terminated At Hour 35 Due To Cell Fire.
5	20110601	ACC-7890	Test Was Terminated At Test Hour 87 Due To Loss Of Oil Temperature Control And Inability To Maintain Load.
6	20110608	ACC-8053	Test Was Terminated At Test Hour 95 Due To Loss Of Oil Temperature Control.
7	20110614	ACC-8011	Test Terminated At Test Hour 95 Due To Loss Of Oil Temperature Control And Excessive Engine Noise And Blowby.
8	20110614	ACC-8076	Test Terminated At Test Hour 93 Due To Loss Of Oil Temperature Control.
9	20110708	ACC-8207	Test Terminated At Test Hour 86 Due To Loss Of Oil Temperture Control, Low Oil Level, And Engine Noise.
10	20110720	ACC-8245	Test Terminated At 87 Hours Due To Loss Of Oil Temperature Control, Excessive Blowby And Decreasing Oil Pressure
11	20110722	ACC-8283	Test Terminated By Lab At Test Hour 99 Due To Loss Of Oil Temperature Control.
12	20110727	ACC-8323	Test Is Non-Interpretable Due To Oil Consumption Greater Than 4.89 Liters.
13	20110805	ACC-8362	Test Was Terminated By Lab At Test Hour 87 Due To Loss Of Load Control.
14	20110808	ACC-8352	Test Terminated By Lab At Test Hour 99 Due To Broken Valve Spring.
15	20110810	ACC-8378	Test Was Terminated By Lab At Test Hour 51 Due To Blown Head Gasket.
16	20110819	ACC-8452	Test Was Terminated At 72 Hours Due To High Blowby.
17	20110824	ACC-8455	Test Terminated At Test Hour 90 Due To Inability To Maintain Load, And Oil Temperatures.
18	20110831	ACC-8495	Test Invalid Due To No Calcium Analysis At End Of Test.
19	20110907	ACC-8529	Lab Declared Test Invalid Due To Incorrect Load Caused By Broken Load Cell.
20	20110907	ACC-8554	Test Was Terminated At Test Hour 3 Due To A Catastrophic Engine Bearing Failure.

***IIIGB - Report Period: OCT 2011***  
***Replicate Database Report***

Components of Replicate Database	OCT 2011	All Periods
Number of Tests	.	28
Formulations	.	13
Labs	.	5
Stands	.	12

**IIIGB - Report Period: OCT 2011**  
**by-Formulation Pooled s and Reproducibility of Replicate Data**

Report Period	Parameter	Degrees of Freedom	Pooled s	R
All	PHOS	15	1.84925	5.17790
All	PHOS (Without SA)	15	1.79024	5.01267

**IIIGB - Report Period: OCT 2011**  
**Pass/Fail**

Report Period	API Category	N	Number Passed	% Passed
OCT 2011	All Categories, All Parameters	94	80	85.1064
OCT 2011	GF-5 - All Parameters	94	80	85.1064
OCT 2011	GF-5, PHOS	94	80	85.1064
OCT 2011	GF-5, PHOS (Without SA)	94	72	76.5957
All	All Categories, All Parameters	664	622	93.6747
All	GF-5 - All Parameters	664	622	93.6747
All	GF-5, PHOS	664	622	93.6747
All	GF-5, PHOS (Without SA)	664	543	81.7771




# Monitoring Agency

6555 Penn Avenue, Pittsburgh, PA 15206

<https://acc-ma.org>

IIIGB

Status of Reported Tests

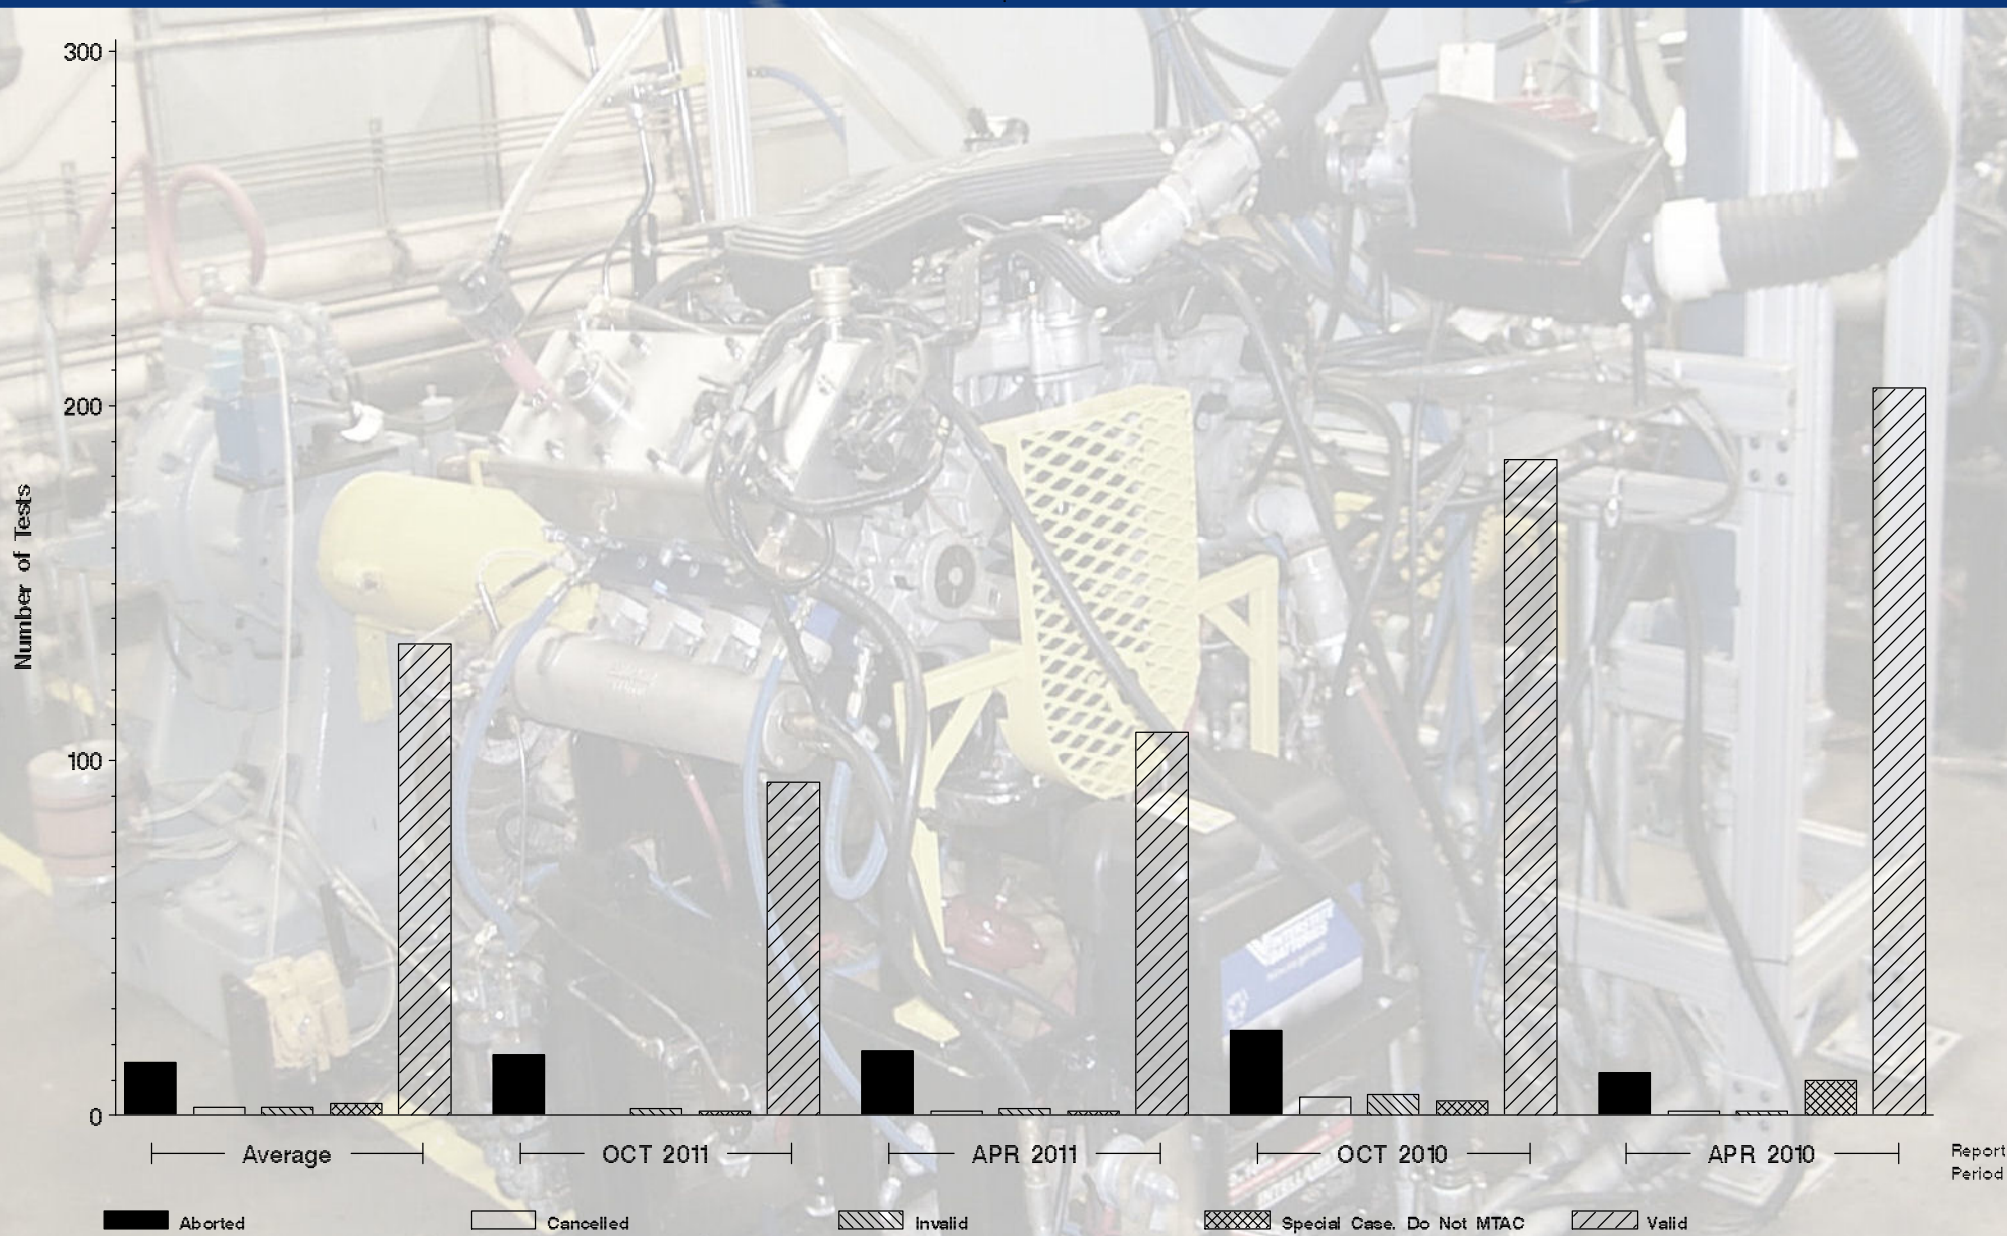






# Monitoring Agency

6555 Penn Avenue, Pittsburgh, PA 15206

<https://acc-ma.org>

IIIGB

Candidate Precision as Represented by Pooled S

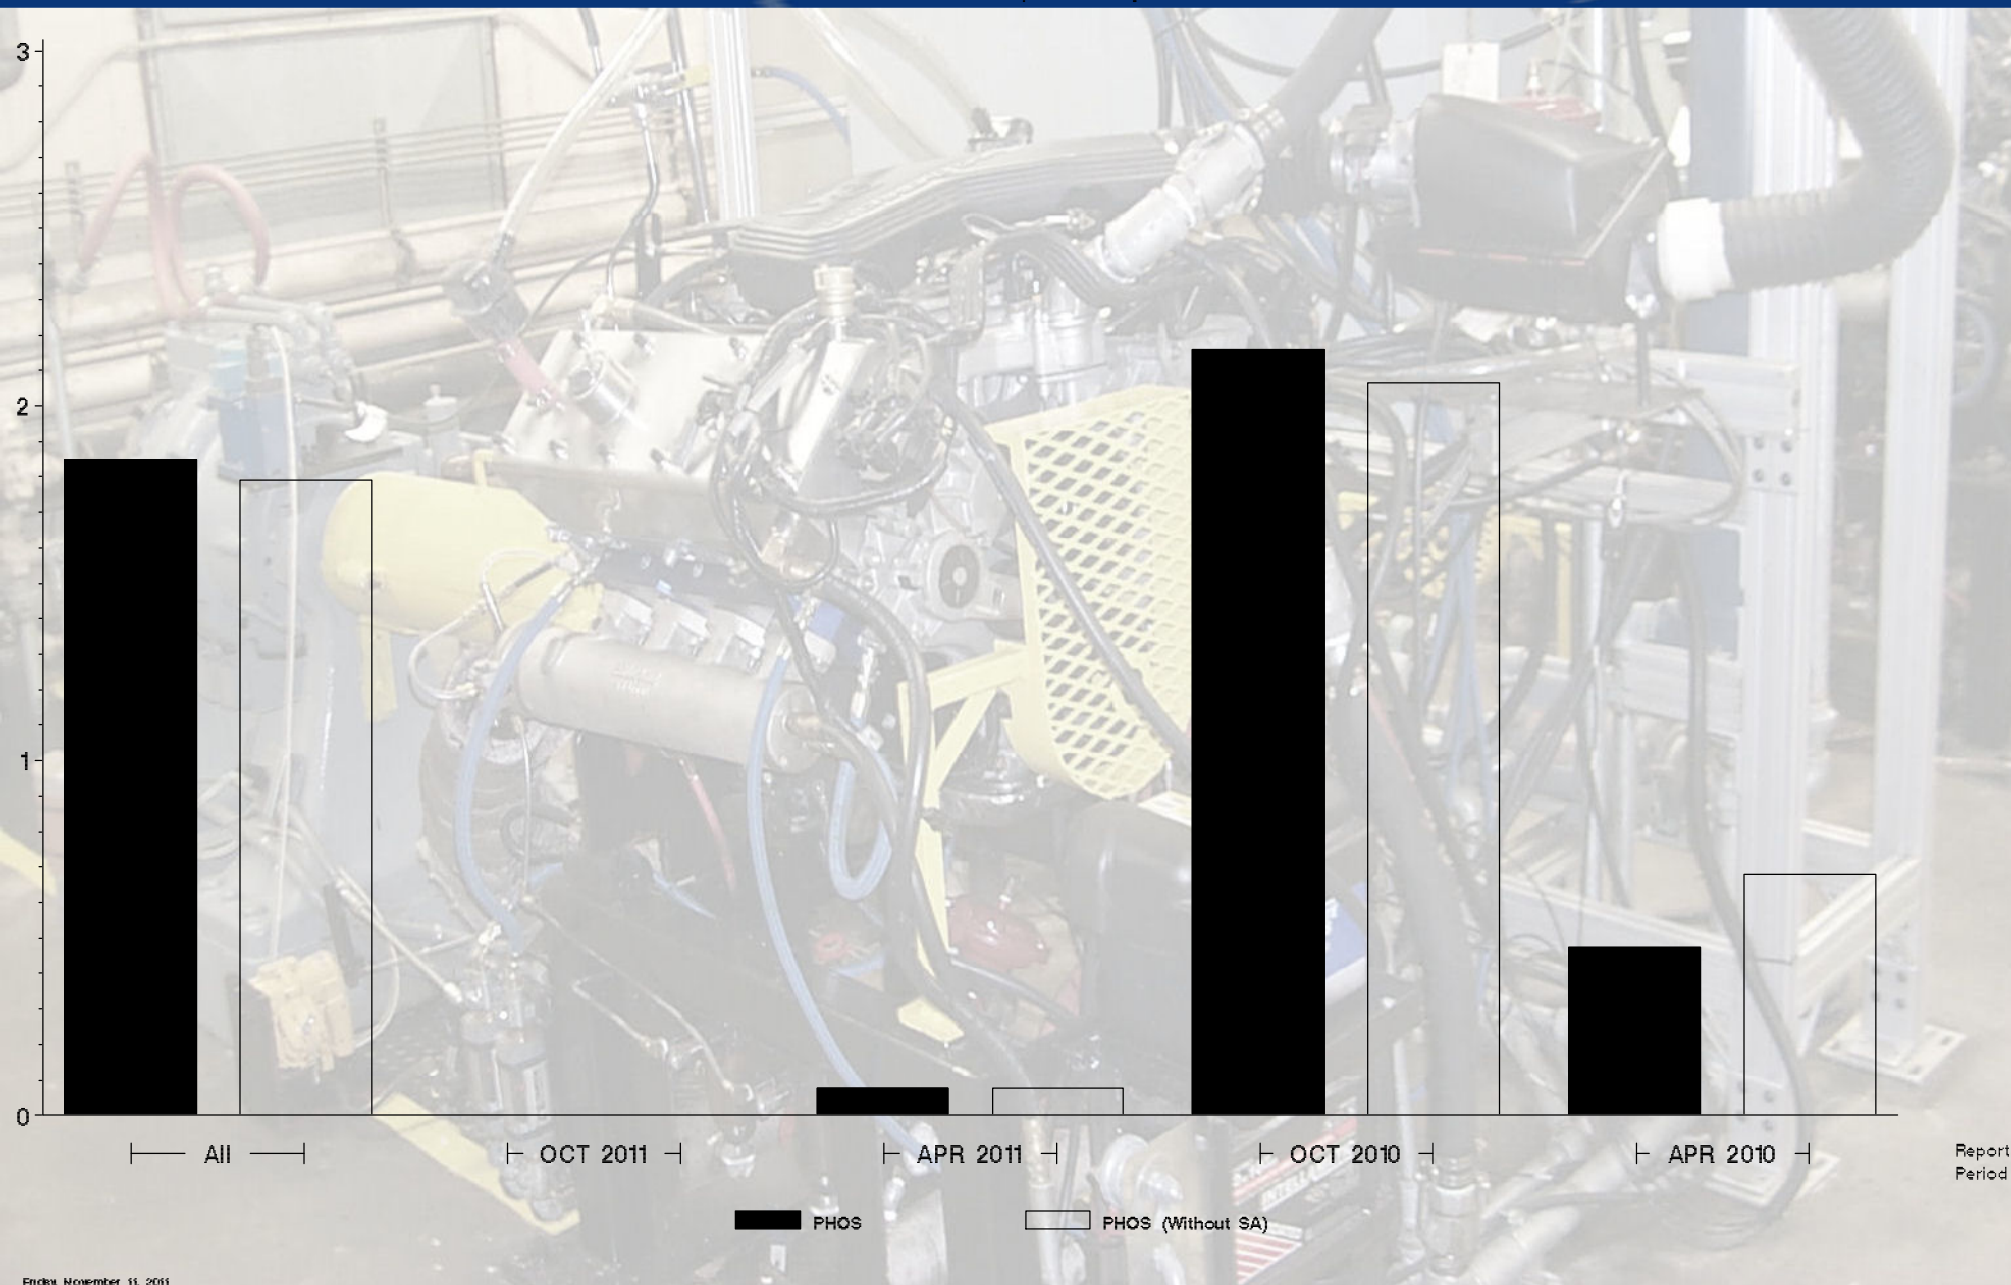



# Monitoring Agency

6555 Penn Avenue, Pittsburgh, PA 15206

<https://acc-ma.org>

IIIGB

Candidate Precision as Represented by Pooled S

