

III GB - Report Period: APR 2010
Status Of Reported Tests

STATUS	COUNT	PERCENT
Aborted	12	5.240
Cancelled	1	0.437
Invalid	1	0.437
Special Case. Do Not MTAC	10	4.367
Valid	205	89.520
Total Reported Tests	229	100.000

IIIGB - Report Period: APR 2010
Itemized Lost Test Report

Obs	Date	TESTKEY	REASON
1	20091014	ACC-3290	Test Was Aborted At 88:24 Hours Due To A Blown Head Gasket.
2	20091022	ACC-3436	This Test Is Not Interpretable Due To Oil Consumption Greater Than 4.65.
3	20091026	ACC-3499	This Test Is Not Interpretable Due To Oil Consumption Greater Than 4.65.
4	20091029	ACC-3540	Test Terminated At 61 Hours Due To Excessive Oil Consumption.
5	20091029	ACC-3519	Terminated At 66 Hours Due To Loss Of Oil Pressure.
6	20091103	ACC-3552	This Test Was Terminated At 46 Hours Due To An Engine Fire.
7	20091106	ACC-3632	Oil Cooler Pump Was Malfunctioning Throughout Test. Maximum Flow To Oil Cooler Was Reduced 50%, And Caused Temperature Control Issues.
8	20091214	ACC-3962	Test Terminated At 26 Hours Due To Mechanical Failure.
9	20091216	ACC-4005	This Test Terminated At 92 Hours Due To Loss Of Oil Temperature Control.
10	20091230	ACC-4011	This Test Is Not Interpretable Due To Oil Consumption Greater Than 4.65.
11	20100111	ACC-4199	Test Is Not Interpretable Due To Oil Consumption Greater Than 4.65.
12	20100112	ACC-4242	Test Declared Invalid Due To Left Head Gasket Failure At 81:55hrs.
13	20100114	ACC-4260	Test Aborted @ Test Hour 8 Due To Number 3 Rod Bearingg Failure.
14	20100122	ACC-4327	Aborted Test @ End Of Break In Due To #1 Rod Bearing Failure.
15	20100215	ACC-4501	Test Terminated At Client Request.
16	20100216	ACC-4510	Terminated Due To High Oil Consumption.
17	20100219	ACC-4559	Non-Interpretable Due To Oil Consumption Greater Than 4.65 Liters.
18	20100219	ACC-4575	Non Interpretable Due To Oil Consumption Greater Than 4.65 Liters.
19	20100224	ACC-4600	Test Not Interpretable Due To Oil Consumption Greater Than 4.65 Liters.
20	20100305	ACC-4540	Test Terminated At 98 Hours 32 Minutes Due To Loss Of Load & Oil Temperature Control.
21	20100317	ACC-4826	Not Interpretable Due To Oil Consumption Greater Than 4.65.
22	20100322	ACC-4860	This Test Is Not Interpretable Due To Oil Consumption Greater Than 4.6
23	20100326	ACC-4915	Test Declared Non-Interpretable Due To Excessive Oil Consumption
24	20100331	ACC-4972	Terminated At 98 Hours Due To Head Gasket Failure. Validity Correction

IIIGB - Report Period: APR 2010
Replicate Database Report

Components of Replicate Database	APR 2010	All Periods
Number of Tests	4	6
Formulations	2	3
Labs	2	3
Stands	3	4

IIIGB - Report Period: APR 2010
by-Formulation Pooled s and Reproducibility of Replicate Data

Report Period	Parameter	Degrees of Freedom	Pooled s	R
APR 2010	PHOS	2	0.47270	1.32357
APR 2010	PHOS (Without SA)	2	0.67779	1.89781
All	PHOS	3	1.67401	4.68723
All	PHOS (Without SA)	3	1.72035	4.81699

III GB - Report Period: APR 2010
Pass/Fail

Report Period	API Category	N	Number Passed	% Passed
APR 2010	All Categories, All Parameters	205	187	91.2195
APR 2010	GF-5 - All Parameters	205	187	91.2195
APR 2010	GF-5, PHOS	205	187	91.2195
APR 2010	GF-5, PHOS (Without SA)	205	156	76.0976
All	All Categories, All Parameters	277	256	92.4188
All	GF-5 - All Parameters	277	256	92.4188
All	GF-5, PHOS	277	256	92.4188
All	GF-5, PHOS (Without SA)	277	210	75.8123




Monitoring Agency

6555 Penn Avenue, Pittsburgh, PA 15206

<https://acc-ma.org>

IIIGB

Status of Reported Tests

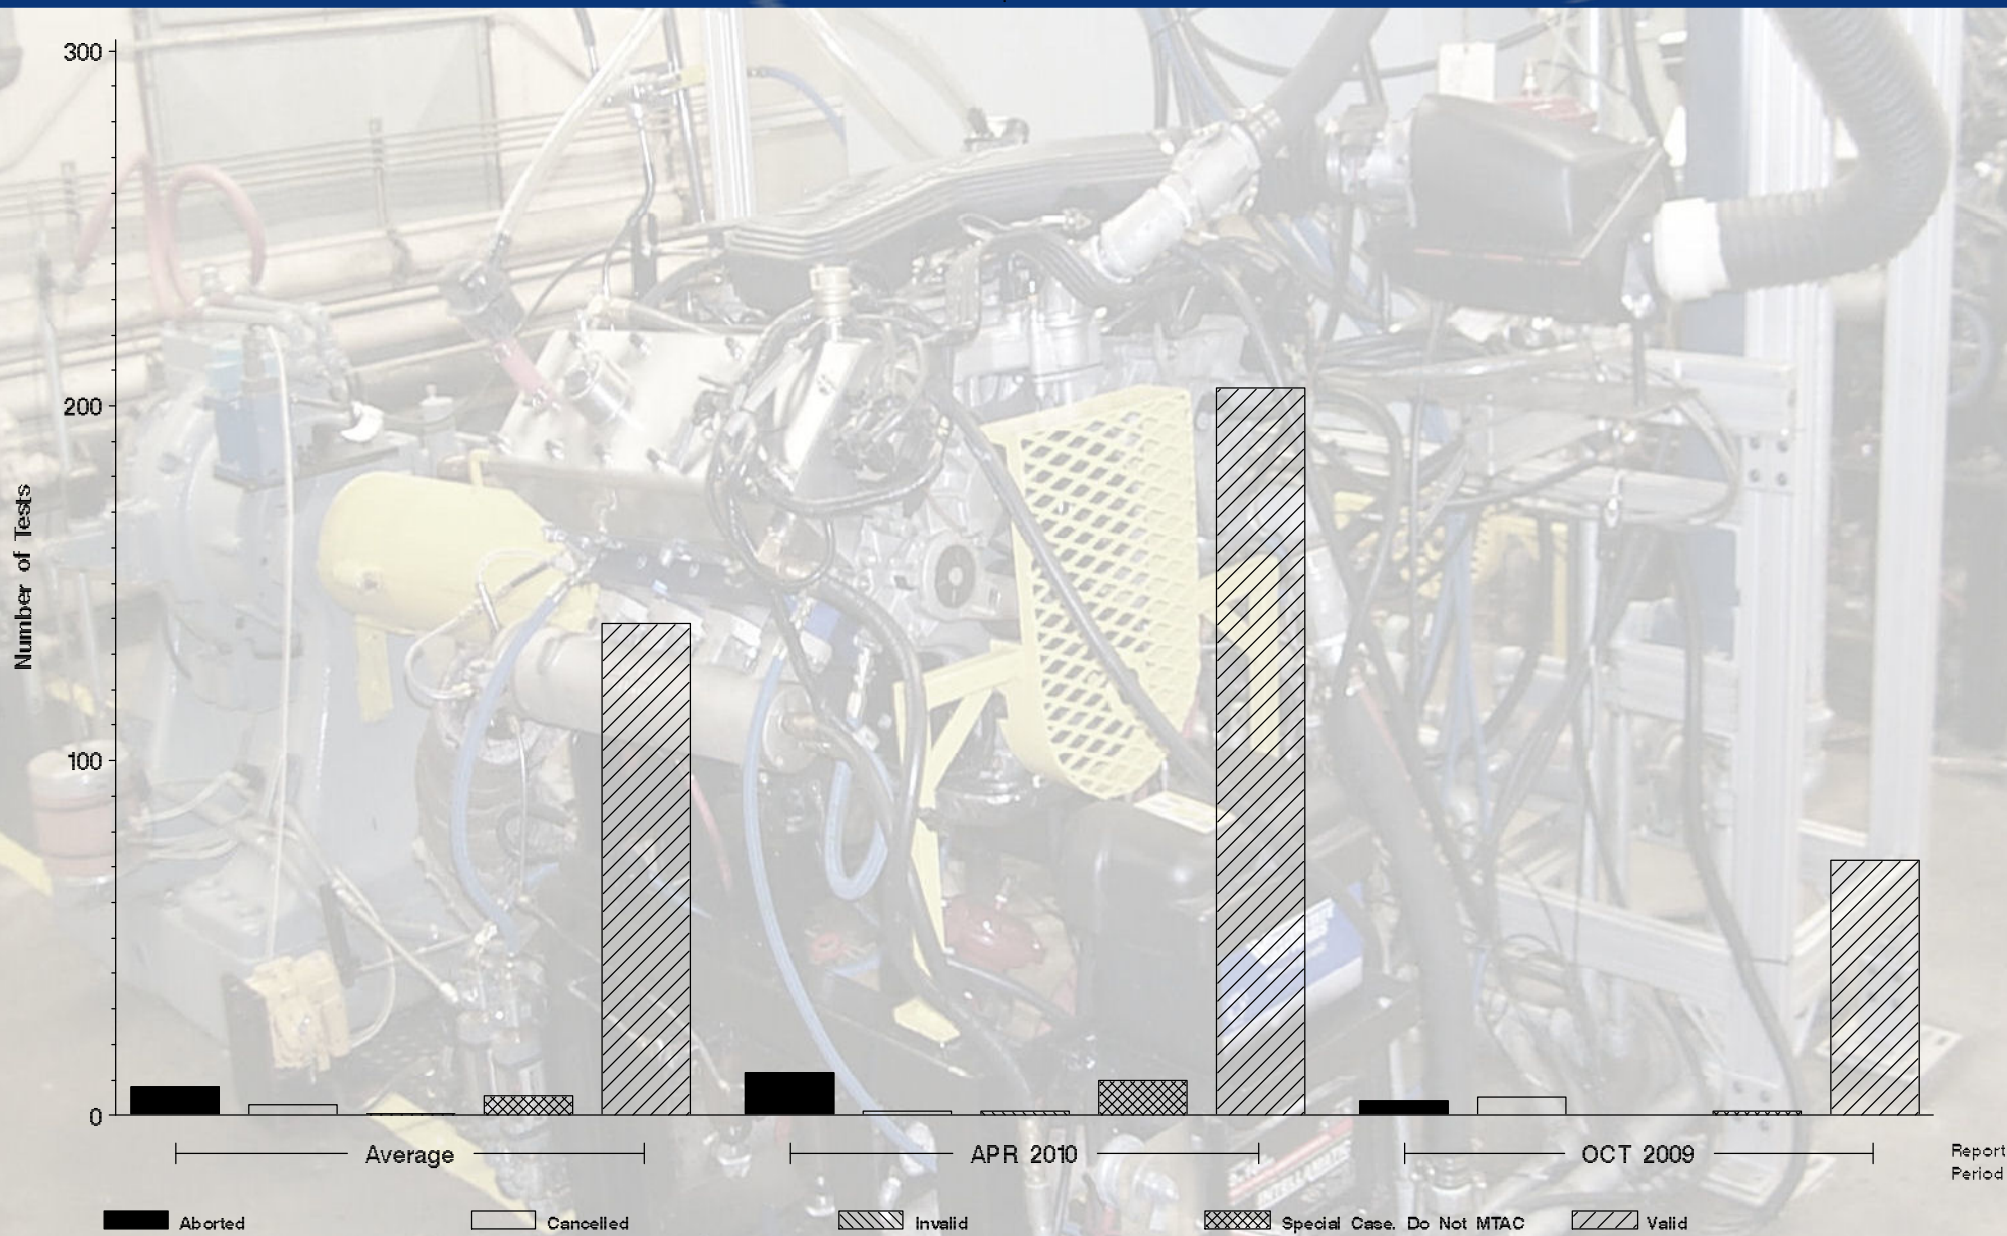




Monitoring Agency

6555 Penn Avenue, Pittsburgh, PA 15206

<https://acc-ma.org>

IIIGB

Candidate Precision as Represented by Pooled S

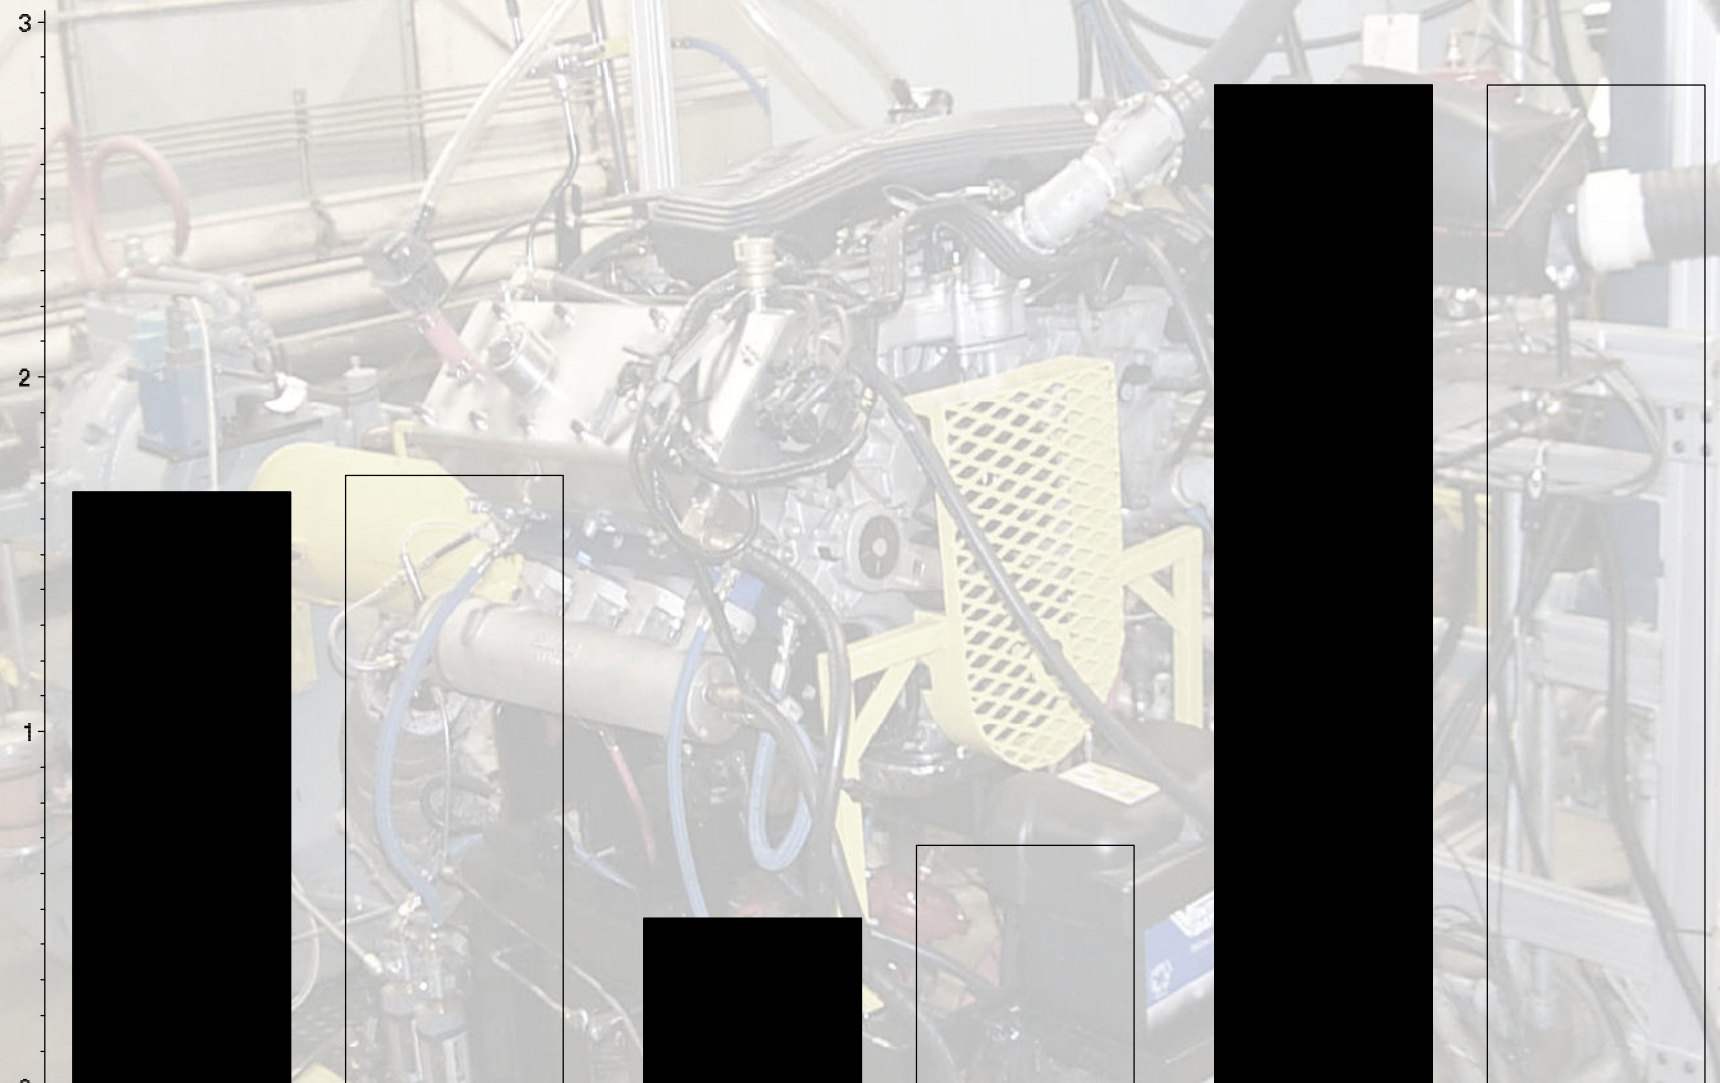

— All —

— APR 2010 —

— OCT 2009 —

Report
Period

■ PHOS

□ PHOS (Without SA)



Monitoring Agency

6555 Penn Avenue, Pittsburgh, PA 15206

<https://acc-ma.org>

IIIGB

Candidate Precision as Represented by Pooled S

